

SERVICE BULLETIN

Subject: Design Change to Water Level in all F and N Prefix Ice Machines

Models affected: F0522, F0822, F1222, F1522, N0422, N0622, N0922 and N1322

The mounting position of the float reservoir has been moved down 3/4 inch which lowers the water level in the evaporator.

The purpose of the change was to reduce the amount of water discharged with the ice. Although some water is normal, excessive water was identified in some units.

Prior Units: If a prior unit is believed to be discharging too much water, lowering the float level by bending the float arm will lower its water level.

Current Units: On units built **after** the change, the water level must NOT be lowered further, but should be level with the mark on the side of the reservoir.

This change began in late June, 2011 with the following serial numbers:

- F0522, F0822, N0422, N0622 models: 11061320014829
- F1222, F1522, N0922, N1322 models: 11061320015331