

---

# SERVICE BULLETIN

---

**Subject: Prodigy Plus Cuber Design Change To The Right Side Panel**

Applies to all D series cubers models include: C0322, C0522, C0722, C0330, C0530, C0630, C0830, C1030, C1448, C1848 and C2148.

**What changes were made:** An alignment bracket has been added to the right side panel. The bracket is there to ensure that the panel liner is properly positioned.

**When the changes were made:** Feb 2016

Units made between Dec 2014 and Feb 2016 do not have alignment bracket.

**Symptoms of an improperly aligned panel liner can include:**

No ice complaint with the controller showing bin full.

- Reduced ice production with the controller showing bin full without a full bin.
- The curtain getting hung up on the panel liner.

**Recommended action:** Units with the above symptoms are suspect to have an improperly positioned panel. To ensure that the panel liner is always properly positioned, order the new right side panels, which include the alignment bracket. The part numbers stay the same and can be found at <http://www.scotsman-ice.com/service/>

