


SERVICE BULLETIN

Subject: Fan Motor Bracket Change, models C0530, C0630 and C0830

The fan motor bracket and fan shrouds on the above models have been changed to a 3 point bracket design. The first unit with this design was built March 11, 2013, it is C0630A-32B, serial number 13031320011477. The new service parts are listed below.

Item	Part Number	Description
1	A39608-001	Shroud Top - C0530 or C0630
	A39601-001	Shroud Top - C0830
2	A40146-001	Fan Shroud - C0530 or C0630
	A40147-001	Fan Shroud - C0830
3	A40148-001	Left fan bracket
4	A40156-001	Right fan bracket, 2 point mounting

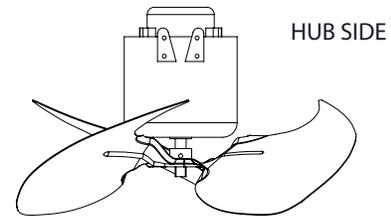

LOCATE FAN BLADE
.25" FROM END OF
MOTOR SHAFT

FAN DETAIL

The prior bracket design positioned the fan blade at the end of the shaft, but when these parts are used the fan blade must be mounted 1/4 inch in from the end of the motor shaft.

There are two kits available that include items 1-4:

- A40146-021 for C0530 or C0630
- A40147-021 for C0830

